


MODEL: CT-F4242, CT-F4040

SUBJECT: Change of motor and circuit modification.

REASON: To improve REW→STOP operation.

JUN 22 1978

	(Old)		(New)
Motor	RXM-027	→	RXM-038
Capacitor	C3 : 2200μF 16V	→	Deleted
	CEA222P16		

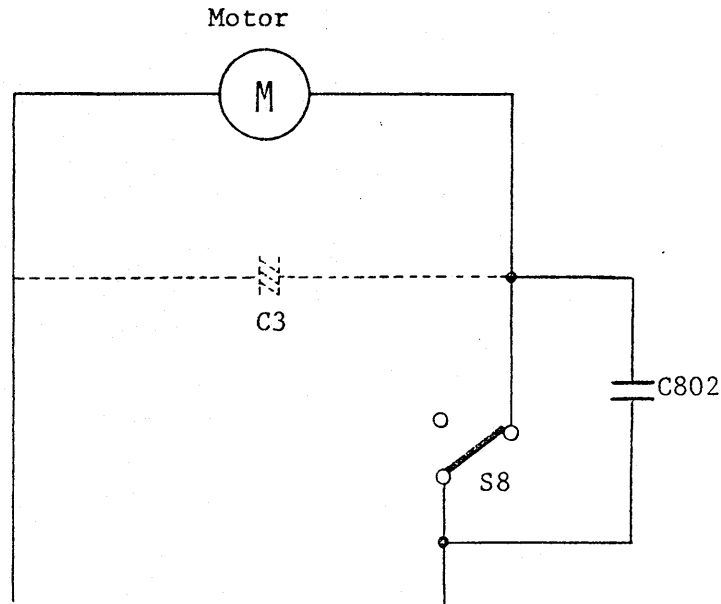

NOTICE: Old and new motors are interchangeable.  
But remove the capacitor (C3) when you replace the motor with new one because Motor has been modified to make turque up.

MODIFICATION CODE: 3

APPLICABLE SERIAL No. :

CT-F4242/KU	3642701~
" /KC	3402301~
CT-F4040/HG	8426501~
" /D	9308501~

APPLICABLE MONTH: Nov. 1977